
HARDIN 11 Industry Dr. Palm Coast, FL 32137 MARINE 386-445-2500 / FAX 386-445-1122

PART NO. 620-60210

TITLE:

MERCURY CABLE ATTACHMENTS FOR N-CONTROLS

www.hardin-marine.com

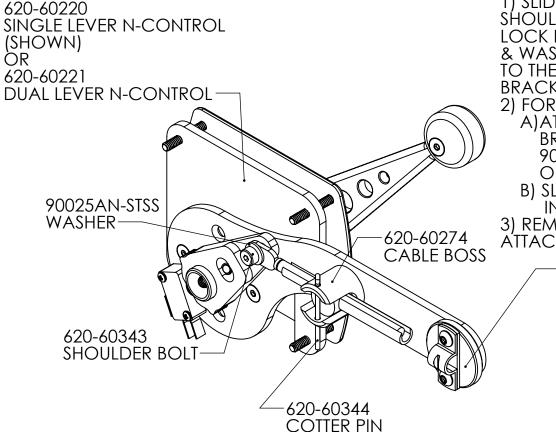

INSTALLATION INSTRUCTIONS:

1) SLIDE 90025AN-STSS 1/4 WASHER ONTO 620-60343 SHOULDER BOLT. THESE PARTS ARE SUPPLIED IN A ZIP LOCK BAG WITH YOUR SHIFTER. SLIDE SHOULDER BOLT & WASHER OVER THE MERCURY CABLE. APPLY LOCTITE TO THE SHOULDER BOLT AND INSTALL INTO THE BRACKET. TORQUE TO 40" LBS.

2) FOR MERCURY GEN 1 CABLES:

A)ATTACH 620-60274 CABLE BOSS TO BRACKET, LIKE SHOWN, WITH THE SUPPLIED 90025C037SFS BOLT (NOT SHOWN). USE LOCTITE ON THE BOLT. TORQUE TO 60" LBS.

B) SLIDE MERCURY CABLE INTO THE CABLE BOSS. INSERT 620-60344 COTTER PIN.

3) REMOVE THE SUPPLIED MERCURY GEN 2 CABLE ATTACHMENT, AS SHOW IF FIG. A.

FIG A.